



Rozměry a tolerance

Tolerance desek PK/PKA, PL/PLA

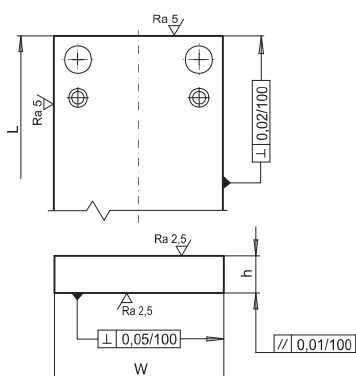

mat.	tolerance		tolerance - h	
	L/W		PK/PKA PL/PLA	PK/PKA 05 PK/PKA 55 PL/PLA
1730, 2085, 2311 2312, 2738 Toolox33, Toolox44 2738HH, 2714HH	≤ 496	+0,15 +0,00	+0,30 +0,15	(rozpěrky)
	> 496 ÷ 1196	+0,20 +0,00	+0,40 +0,20	
2083, 2162 2343, 2767	≤ 496	+0,15 +0,00	+0,60	+0,05 +0,00
	> 496 ÷ 1196	+0,20 +0,00	+0,40	


Otvory pro sloupky a pouzdra

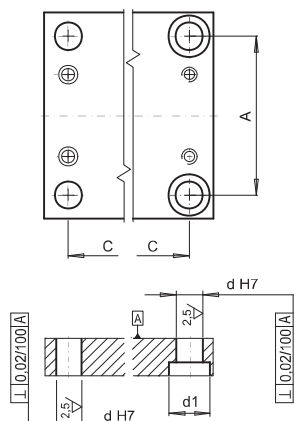

d			tolerance
PK/PKA	PK31	PKA31	H7
14	13,75	13,8	+0,018 -0,000
20	19,6	19,7	+0,021 -0,000
26	25,5	25,6	
30	29,4	29,5	+0,025 -0,000
42	41,3	41,4	
54	53,2	-	+0,030
66	-	-	-0,000
A/C			tolerance
75 ÷ 180			± 0,010
> 180 ÷ 315			± 0,012
> 315 ÷ 500			± 0,015
> 500 ÷ 892			± 0,018
> 892			± 0,024




d	PK / PKA						PKA	tolerance
	14	20	26	30	42	54	66	
d1	16,5	26	32	36	48	61	72	± 0,018
s	3,2		6,3			10,3		± 0,024

Otvory pro šrouby

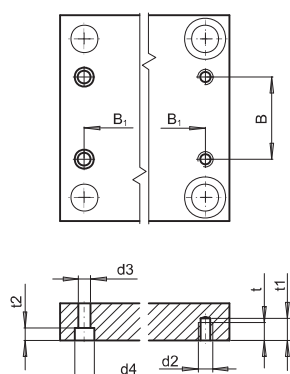

d2	M -	M4	M5	M6	M8	M10	M12	M16	M20	M24
∅	4	5	6	8	10	12	16	20	24	
d3	∅	4,3	5,5	7	9	11	14	18	22	26
	Tol.	+0,18	+0,18	+0,22	+0,22	+0,27	+0,27	+0,27	+0,33	+0,33
d4	∅	8	10	11	15	18	20	26	33	38
	Tol.	+0,27	+0,27	+0,27	+0,27	+0,27	+0,33	+0,33	+0,39	+0,39
t	PK	7	-	7	-	15	18	24	32	-
	PKA	-	10	-	14	19	25	26	32	38
t1	PK	11	-	10	-	20	25	34	44	-
	PKA	-	14	-	20	25	32	34	43	52
t2	PK	-	-	8,4	11	13	15,5*	21**	26	-
	PKA	-	-	8,4	9	11	13	17	21,5	25,5
B; B1	≤ 120		± 0,20							
	> 140 ÷ 400		± 0,25							
	> 400 ÷ 930		± 0,35							

Středící otvory a vybrání v PK/PKA 35

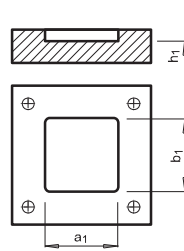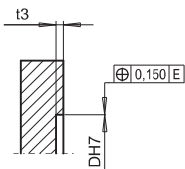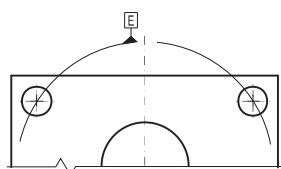

parametr	rozměr	tolerance
DH7	60	+0,030 -0,000
	90	+0,035 -0,000
t3	4	+0,250
a1, b1, h1	na přání	+0,030 -0,000