


# C2713

## Nástrojová tlačná pružina, Střední zatížení (modrá)



\* Parametr "R [N/mm]" je síla potřebná ke stlačení pružiny o 1 mm.

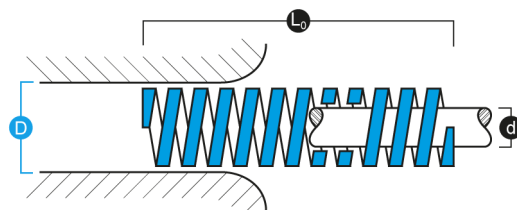

kód	D	d	L0	R [N/mm]*
C2713/10x25	10	5	25	16
C2713/10x32	10	5	32	13
C2713/10x38	10	5	38	11,9
C2713/10x44	10	5	44	10,3
C2713/10x51	10	5	51	8,9
C2713/10x64	10	5	64	7,5
C2713/10x76	10	5	76	5,3
C2713/10x305	10	5	305	1,6
C2713/12,5x25	12,5	6,3	25	30
C2713/12,5x32	12,5	6,3	32	24,8
C2713/12,5x38	12,5	6,3	38	21,4
C2713/12,5x44	12,5	6,3	44	18,5
C2713/12,5x51	12,5	6,3	51	15,5
C2713/12,5x64	12,5	6,3	64	12,1
C2713/12,5x76	12,5	6,3	76	10,2
C2713/12,5x89	12,5	6,3	89	8,4
C2713/12,5x102	12,5	6,3	102	6,3
C2713/12,5x305	12,5	6,3	305	2,1
C2713/16x25	16	8	25	49,4
C2713/16x32	16	8	32	37,1
C2713/16x38	16	8	38	33,9
C2713/16x44	16	8	44	30
C2713/16x51	16	8	51	26,4
C2713/16x64	16	8	64	20,5

kód	D	d	L0	R [N/mm]*
C2713/16x76	16	8	76	17,8
C2713/16x89	16	8	89	15,2
C2713/16x102	16	8	102	13,5
C2713/16x115	16	8	115	11,8
C2713/16x305	16	8	305	4,8
C2713/20x25	20	10	25	98
C2713/20x32	20	10	32	72,6
C2713/20x38	20	10	38	56
C2713/20x44	20	10	44	47,5
C2713/20x51	20	10	51	41,7
C2713/20x64	20	10	64	32,3
C2713/20x76	20	10	76	25,1
C2713/20x89	20	10	89	22
C2713/20x102	20	10	102	19,8
C2713/20x115	20	10	115	18,1
C2713/20x127	20	10	127	16,6
C2713/20x139	20	10	139	15,1
C2713/20x152	20	10	152	13,2
C2713/20x305	20	10	305	6,1
C2713/25x25	25	12,5	25	147
C2713/25x32	25	12,5	32	118
C2713/25x38	25	12,5	38	93
C2713/25x44	25	12,5	44	80,8
C2713/25x51	25	12,5	51	68,6
C2713/25x64	25	12,5	64	53
C2713/25x76	25	12,5	76	43,2
C2713/25x89	25	12,5	89	38,2
C2713/25x102	25	12,5	102	33
C2713/25x115	25	12,5	115	28
C2713/25x127	25	12,5	127	25,9
C2713/25x139	25	12,5	139	23,2
C2713/25x152	25	12,5	152	20,8
C2713/25x178	25	12,5	178	17,8
C2713/25x203	25	12,5	203	15,8
C2713/25x305	25	12,5	305	10,2
C2713/32x38	32	16	38	185
C2713/32x44	32	16	44	158
C2713/32x51	32	16	51	134
C2713/32x64	32	16	64	99
C2713/32x76	32	16	76	80,5
C2713/32x89	32	16	89	69,1

kód	D	d	L0	R [N/mm]*
C2713/32x102	32	16	102	58,8
C2713/32x115	32	16	115	51,5
C2713/32x127	32	16	127	44,8
C2713/32x139	32	16	139	42,3
C2713/32x152	32	16	152	37,8
C2713/32x178	32	16	178	32,5
C2713/32x203	32	16	203	28,9
C2713/32x254	32	16	254	21,4
C2713/32x305	32	16	305	18,3
C2713/40x51	40	20	51	181,6
C2713/40x64	40	20	64	140
C2713/40x76	40	20	76	108
C2713/40x89	40	20	89	90,7
C2713/40x102	40	20	102	81
C2713/40x115	40	20	115	71,8
C2713/40x127	40	20	127	62,7
C2713/40x139	40	20	139	57,5
C2713/40x152	40	20	152	51,6
C2713/40x178	40	20	178	44,1
C2713/40x203	40	20	203	36,7
C2713/40x254	40	20	254	30,1
C2713/40x305	40	20	305	24,6
C2713/50x64	50	25	64	209
C2713/50x76	50	25	76	168
C2713/50x89	50	25	89	140
C2713/50x102	50	25	102	119
C2713/50x115	50	25	115	106
C2713/50x127	50	25	127	97
C2713/50x139	50	25	139	87
C2713/50x152	50	25	152	80
C2713/50x178	50	25	178	69,5
C2713/50x203	50	25	203	59,8
C2713/50x229	50	25	229	50,9
C2713/50x254	50	25	254	43,9
C2713/50x305	50	25	305	38,6
C2713/63x76	63	38	76	312
C2713/63x89	63	38	89	260
C2713/63x102	63	38	102	221
C2713/63x115	63	38	115	187
C2713/63x127	63	38	127	168
C2713/63x152	63	38	152	136

kód	D	d	L0	R [N/mm]*
<b>C2713/63x178</b>	63	38	178	114
<b>C2713/63x203</b>	63	38	203	100
<b>C2713/63x229</b>	63	38	229	89,2
<b>C2713/63x254</b>	63	38	254	78,4
<b>C2713/63x305</b>	63	38	305	64,7